


Solution to the problem of collision between OAG's bolt and filterwheel's bolt Rev 1.0

Some users told us that OAG's bolt sometimes will collide filterwheel's bolt as shown in the picture below



If you run into this problem, you can solve it by following the guide below.

1. Unscrew the four screws inside the OAG

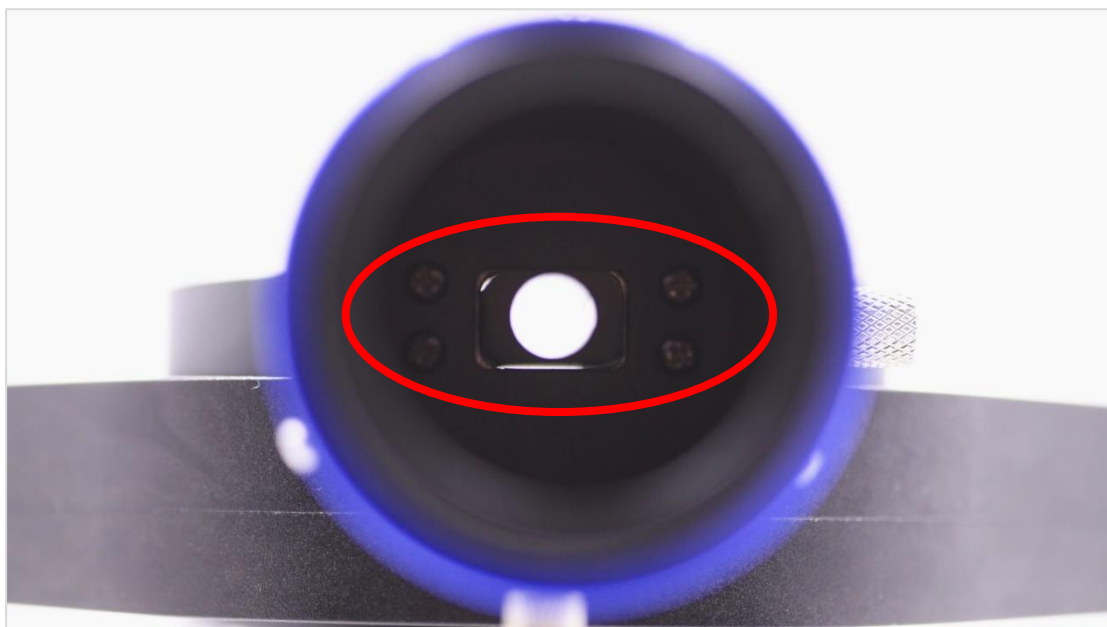

2. Detach the upper half in the red rectangular from the lower half, and rotate the upper half 180 degrees in the horizontal direction as shown below so that the bolt colliding with filterwheel's bolt will now point to the opposite direction.



3. After you rotate the upper half and fasten the screws unscrewed in the first step, the OAG should look like this:



4. OAG is ready to use after you reinstall it on filterwheel.

After you go through these procedures, the OAG's bolt will not collide with filterwheel's bolt, and the OAG will still work very well.